

Service Bulletin

Mazda Motor of America, Inc.
7755 Irvine Center Drive
Irvine, California 92718
Telephone (714) 727-1990



Category B	Applicable Model/s 1993-97 626/MX-6 1995-97 Millenia	Subject OIL LEAK AT VALVE COVER	Bulletin No. 007/97
			Issued 10/23/97
			Revised

APPLICABLE MODELS/VINS


1993 - 97 626 with a KL engine
1995 - 97 Millenia with a KL engine and a VIN of JM1TA221*V1317697 and lower.

DESCRIPTION

Oil may seep through the valve cover gasket and result in the following concerns:

- Unusual Smell - Oil Consumption - Misfire (If oil enters the spark plug hole)

This concern may result from the gasket becoming hard due to age. The configuration of the gasket has changed to improve sealing performance. Customers complaining of this concern should have the vehicle inspected and if necessary, new parts installed.

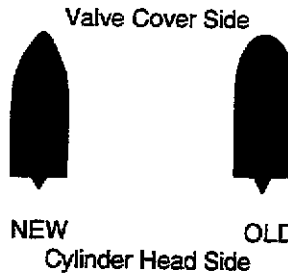

PARTS INFORMATION

Part Number		Description	Inter.	Qty.
New	Old			
KL01-10-2D5B	KL01-10-2D5A	Cylinder Head Cover Gasket (L)	AN	1
KL01-10-235B	KL01-10-235A	Cylinder Head Cover Gasket (R)	AN	1

Interchangeability Note: AN = The new part and the old part are fully interchangeable.

WARRANTY INFORMATION

(Applies To Verified Customer Complaints On Vehicles Covered Under Normal Warranty. Refer To The SRT Microfiche For Warranty Term Information).

Warranty Type: A
Symptom Code: 76
Damage Code: 9E
Part Number Main Cause: KL01-10-2D5B or KL01-10-235B
Quantity: 1
Operation / Labor Hours:

626 / MX-6	B0403ARX / 1.7 Hrs.	R&R Right Side	Millenia	B0403DRX / 2.2 Hrs.	R&R Right Side
	B0403BRX / 0.4 Hrs.	R&R Left Side		B0403ERX / 0.3 Hrs.	R&R Left Side
	B0403CRX / 1.8 Hrs.	R&R Both Sides		B0403FRX / 2.3 Hrs.	R&R Both Sides

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.