

Service Bulletin

Mazda Motor of America, Inc.
7755 Irvine Center Drive
Irvine, California 92718
Telephone (714) 727-1990



Category S	Applicable Model/s 1995 Millenia	Subject ASSIST HANDLE DETACHMENT	Bulletin No. 027/94
			Issued 8/10/94
			Revised

APPLICABLE MODELS/VINS

1995 Millenia vehicles with a VIN of JM1TA22**S1100001 through JM1TA22**S1101025.

NOTE: The asterisk (*) in the VIN can be any number (0 - 9) or X.


DESCRIPTION

During normal use, the assist handle cap located above the door may become detached. This is caused by a variation in the thickness of the ceiling padding. If the ceiling padding is too thick, the assist handle cap is pushed outward.

To correct this problem, production of the ceiling padding has been improved to provide a more uniform thickness.

REPAIR PROCEDURE

1. Remove the assist handle.
2. Insert a spacer between the handle bracket and the body.
3. Install the assist handle with a new cap.

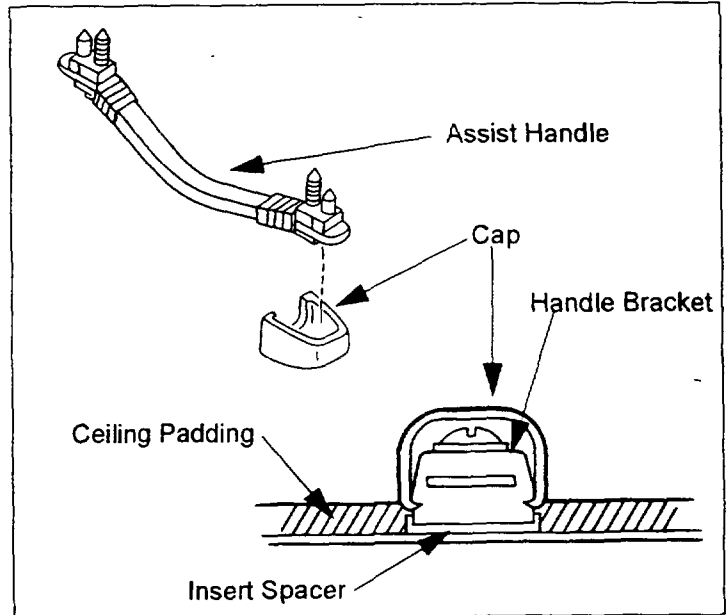

PARTS INFORMATION

Part Number	Description	Quantity
99952 0822	Spacer	6
C001 69 472B 06	Assist Handle Cap, Light Gray	6
C001 69 472B 80	Assist Handle Cap Light Beige	6

WARRANTY INFORMATION

(Vehicles Covered Under Normal Warranty)

Warranty Type: A
Customer Comment Code: 91
Damage Code: 9B
Part Number: C001 69 472B 06 or C001 69 472B 80
Quantity: 6
Operation Number: XX0656RX
Labor Hours: 0.4 Hrs.

Index # **040052**

IMPORTANT: Service and Parts Managers should read this bulletin carefully, sign and convey all information to those concerned.

Signature _____ Signature _____
Service Manager Parts Manager