

Subject: LACK OF HEAT IN PASSENGER COMPARTMENT	Bulletin No: 07-002/02
	Last Issued: 04/22/2002

APPLICABLE MODEL(S)/VINS

2001 Millenia models with VINs lower than JM1 TA22** 11 714921, or built before May 9, 2001.


DESCRIPTION

During normal heater usage, the customer may complain of a lack of heat in the passenger compartment. This may occur even if the auto mode temperature control is set high (77 degrees F or higher). The cause may be due to incorrect logic in the A/C amplifier.

To correct this concern, replace the A/C amplifier with a revised part using the following information.

REPAIR PROCEDURE

1. Verify customer concern.
2. Follow the Workshop Manual (section 07-40 CLIMATE CONTROL COMPONENT DISASSEMBLY/ASSEMBLY), and replace the A/C Amplifier with a revised part.

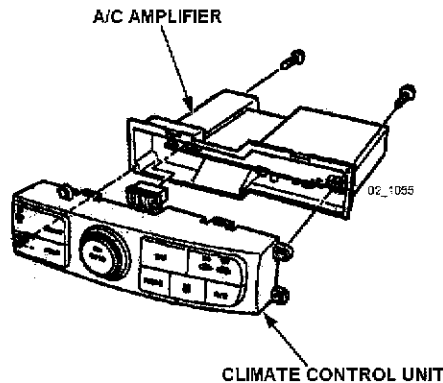

3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
TC86 61 790C	Auto A/C Amplifier	1	Degrees F

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.

Bulletin No: 07-002/02	Last Issued: 04/22/2002
------------------------	-------------------------

WARRANTY INFORMATION

Note: This information applies to verified customer complaints on vehicles covered under normal warranty. Refer to the SRT microfiche for warranty term information.

Warranty Type	A
Symptom Code	59
Damage Code	9W
Part Number Main Cause	TC86 61 790C
Quantity	1
Operation Number / Labor Hours:	XX364XRX / 0.4 Hrs