

Service Bulletin

Mazda Motor of America, Inc.
7755 Irvine Center Drive
Irvine, California 92718
Telephone (714) 727-1990

Category B	Applicable Model/s 1995 - 96 Millenia	Subject No. 1 ENGINE MOUNT MODIFICATION	Bulletin No.	001/96
			Issued	04/18/96
			Revised	


APPLICABLE MODELS / VINS

1995 - 96 Millenia with a VIN of JM1TA22**T1208030 and lower.

DESCRIPTION

To improve efficiency during production, the No. 1 engine mount rubber and insulator design have changed. The changes are shown below.

NOTE: This change could affect replacement part orders. Dealer personnel should inspect the vehicle prior to placing orders.

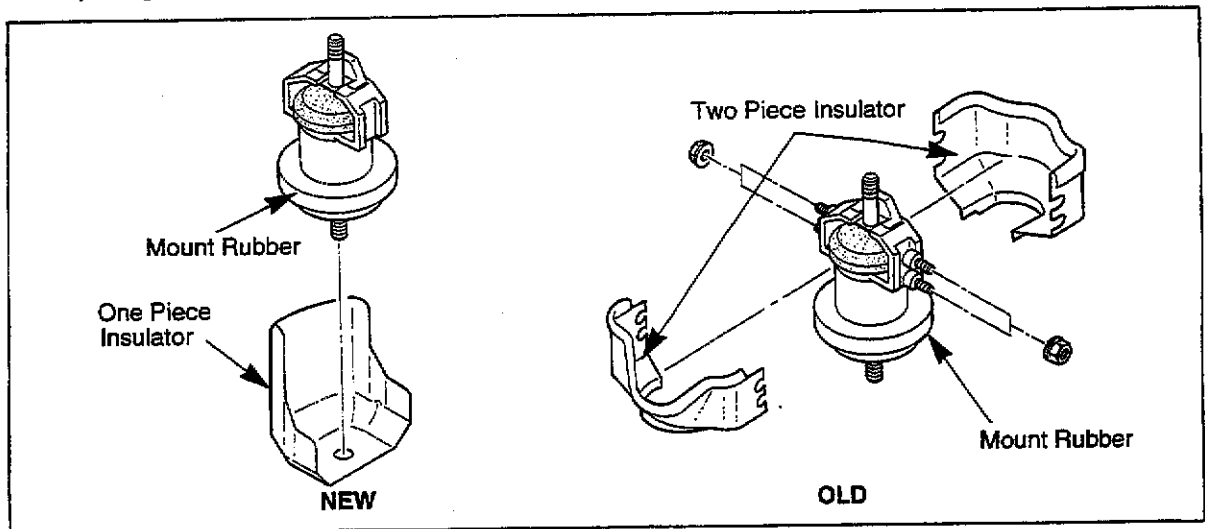

PARTS INFORMATION

Part Number		Description	Qty	Inter.	Applicable Engine
New	Old				
T001 39 040D	T001 39 040C	Rubber Engine Mount, No. 1	1	N	2500cc
T006 39 040D	T006 39 040C	Rubber Engine Mount, No. 1	1	N	2300cc
T002 39 621	T001 39 621	Insulator, Heat	1	N	All
----	T001 39 611	Insulator, Heat	1	---	All

Interchangeability Note: The new and old parts are not interchangeable between each other. Set "A" and "B" (shown below) can be used in place of each other.

**** 39 040C
T001 39 621
T001 39 611
Set "A"

**** 39 040D
T002 39 621
Set "B"

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.

059889